

# Drying Log

1234 Andes Ln, San Marcos, Tx

**CUSTOMER**

## NAME

Example Job - James Vasquez

## PHONE

(123) 456-7890

## EMAIL

james@gmail.com

**JOB**

## TYPE OF LOSS

Water

## WATER CATEGORY

Category 2

## INSURANCE CARRIER

USAA

**CLAIM**

## CLAIM ID

044-8921-W3

## POLICY NUMBER

HO3-49281109-26

## ASSIGNMENT ID


ASN-99281-XM

## ADJUSTER

Marcus Vance

Moisture Maps


Main Level

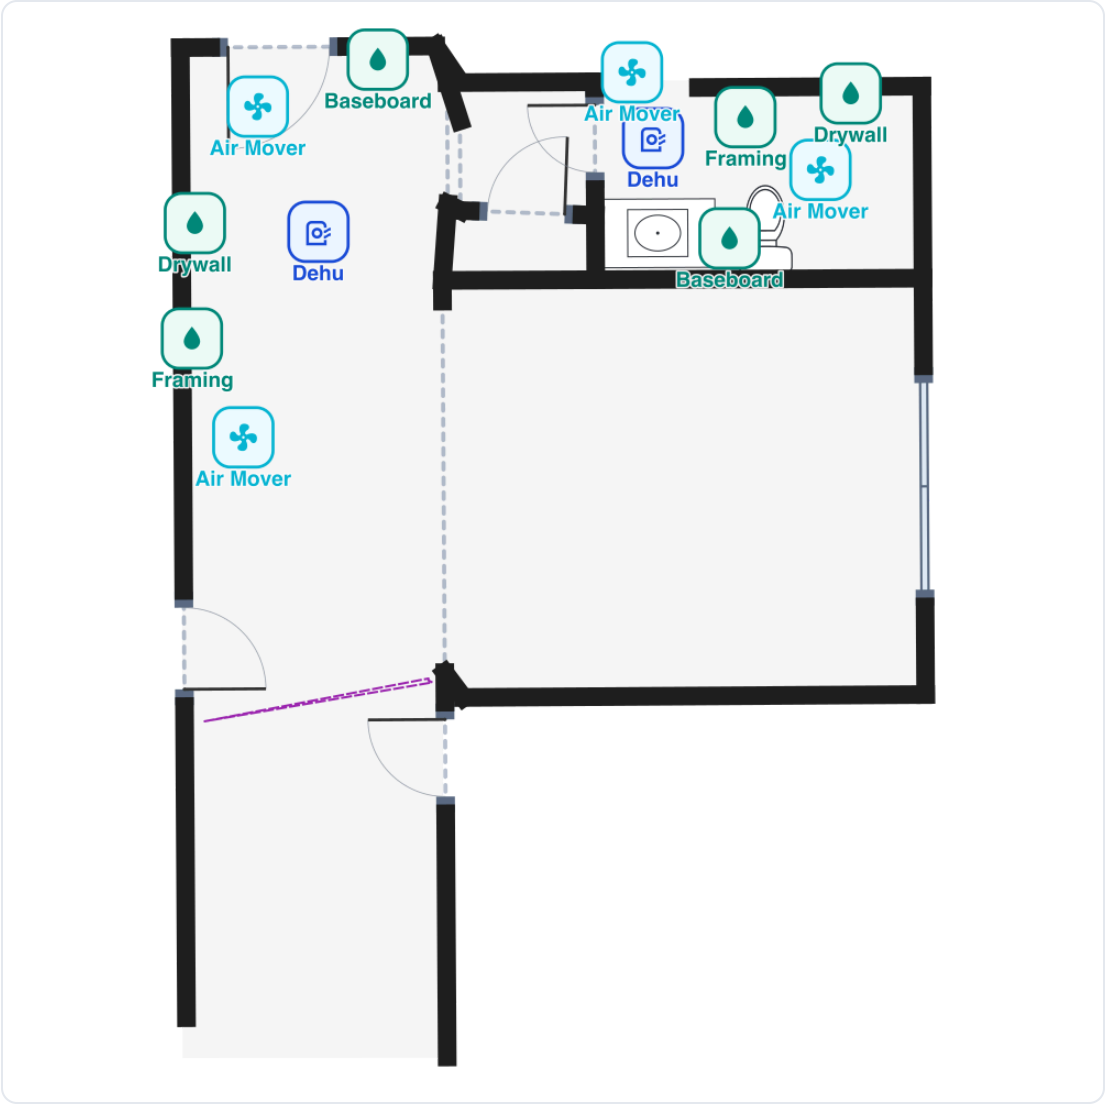

Reference readings

|            | JUL 24                | JUL 25                | JUL 26                | JUL 27                |
|------------|-----------------------|-----------------------|-----------------------|-----------------------|
| Outside    | 87°F · 60%<br>116 GPP | 88°F · 54%<br>108 GPP | 88°F · 52%<br>103 GPP | 88°F · 58%<br>116 GPP |
| Unaffected | 72°F · 49%<br>57 GPP  | 70°F · 49%<br>53 GPP  | 69°F · 48%<br>50 GPP  | 69°F · 51%<br>54 GPP  |

Atmospheric GPP

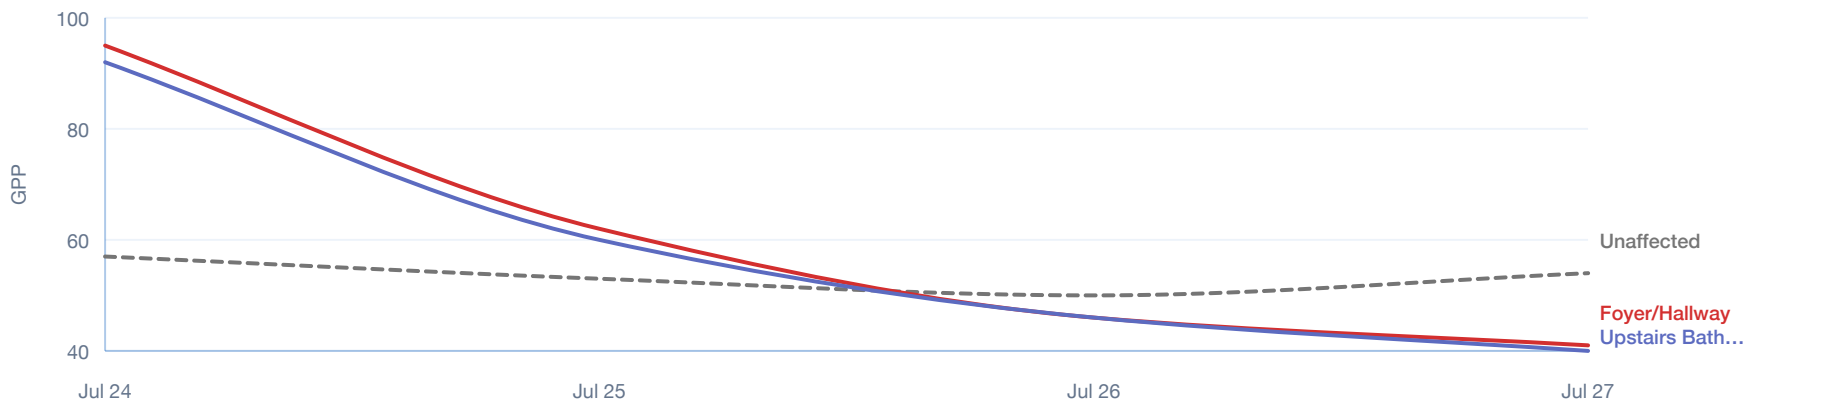


Foyer/Hallway


Class 2

|                         | JUL 24                       | JUL 25                       | JUL 26                       | JUL 27                       |
|-------------------------|------------------------------|------------------------------|------------------------------|------------------------------|
| Room air                | 75°F · 73%<br>95 GPP         | 79°F · 42%<br>62 GPP         | 80°F · 30%<br>46 GPP         | 79°F · 28%<br>41 GPP         |
| Moisture points         |                              |                              |                              |                              |
| Drywall<br>DRY STD 1%   | 21.8%                        | 12.6%                        | 6.4%                         | 0.8%                         |
| Baseboard<br>DRY STD 9% | 16.8%                        | 13.2%                        | 10.6%                        | 8.7%                         |
| Framing<br>DRY STD 15%  | 24.7%                        | 20.1%                        | 16.5%                        | 14.5%                        |
| Dehumidifiers           |                              |                              |                              |                              |
| Dehu                    | 92°F · 23%<br>51 GPP · 44 GD | 95°F · 16%<br>39 GPP · 23 GD | 94°F · 13%<br>31 GPP · 15 GD | 92°F · 13%<br>29 GPP · 12 GD |


Moisture Points

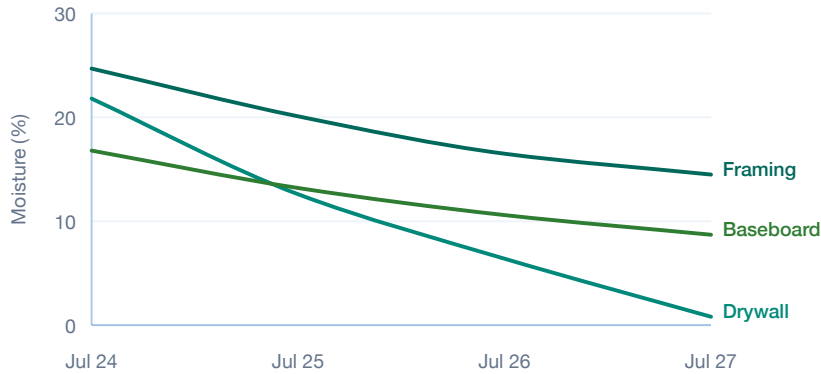

Dehumidifiers

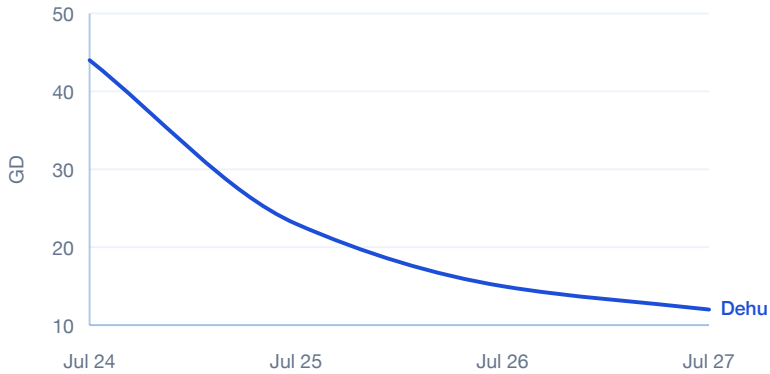

Photos

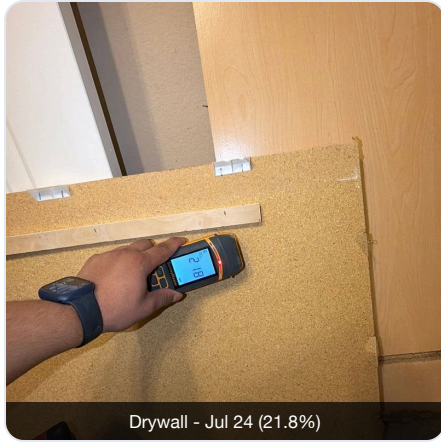

Drywall - Jul 24 (21.8%)



Baseboard - Jul 24 (16.8%)





Framing - Jul 24 (24.7%)

Upstairs Bathroom

Class 2

|                         | JUL 24                       | JUL 25                       | JUL 26                       | JUL 27                       |
|-------------------------|------------------------------|------------------------------|------------------------------|------------------------------|
| Room air                | 74°F · 73%<br>92 GPP         | 78°F · 42%<br>60 GPP         | 79°F · 31%<br>46 GPP         | 78°F · 28%<br>40 GPP         |
| Moisture points         |                              |                              |                              |                              |
| Baseboard<br>DRY STD 9% | 19.5%                        | 14%                          | 11.2%                        | 8.8%                         |
| Drywall<br>DRY STD 1%   | 99%                          | 53.5%                        | 21.8%                        | 1%                           |
| Framing<br>DRY STD 15%  | 29%                          | 14.3%                        | 13.7%                        | 13.1%                        |
| Dehumidifiers           |                              |                              |                              |                              |
| Dehu                    | 91°F · 23%<br>50 GPP · 42 GD | 94°F · 16%<br>38 GPP · 22 GD | 93°F · 13%<br>30 GPP · 16 GD | 91°F · 13%<br>28 GPP · 12 GD |

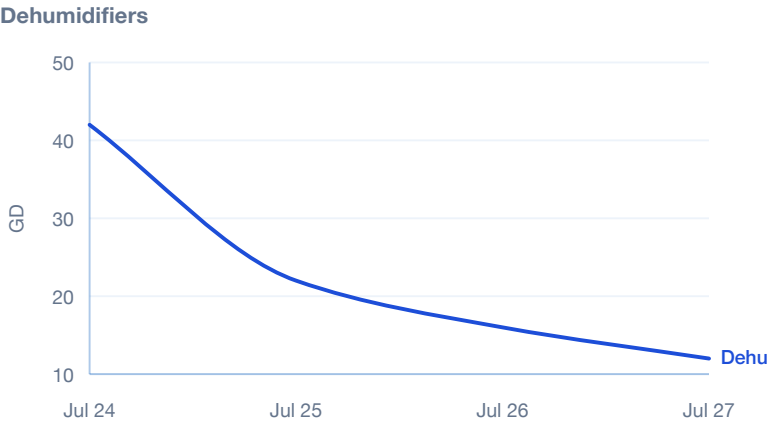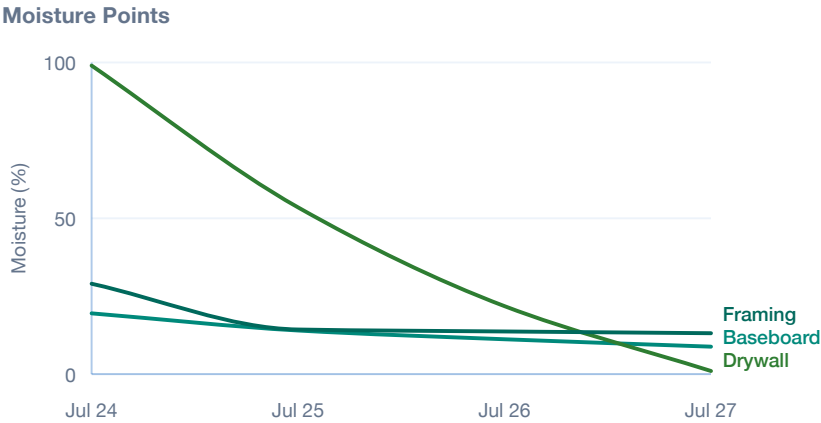

Photos



Baseboard - Jul 24 (19.5%)



Dehu - Jul 24 (91°F · 23%)